


# Connections of Cable to Cable

## Type CAPC

Type CAPC  
Tap cable to a through cable.  
Also see Type CATA, page 7

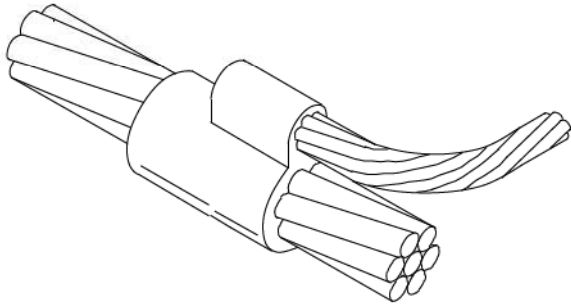

Conductor Size*		Welder Part No.†	Welder Price	Weld Metal
Run	Tap			
6 Stranded	6 Stranded	CAPCT-1H1H	CAT	CA25
	6 Solid	CAPCT-1H1G	CAT	CA25
	8 Stranded	CAPCT-1H1E	CAT	CA25
	8 Solid	CAPCT-1H1D	CAT	CA25
4 Stranded	4 Stranded	CAPCT-1L1L	CAT	CA32
	6 Stranded	CAPCT-1L1H	CAT	CA32
	6 Solid	CAPCT-1L1G	CAT	CA32
	8 Stranded	CAPCT-1L1E	CAT	CA32
	8 Solid	CAPCT-1L1D	CAT	CA32
2 Stranded	2 Stranded	CAPCP-1V1V	CAP	CA65
	4 Stranded	CAPCP-1V1L	CAP	CA45
	6 Stranded	CAPCT-1V1H	CAT	CA32
	6 Solid	CAPCT-1V1G	CAT	CA32
	8 Stranded	CAPCT-1V1E	CAT	CA32
	8 Solid	CAPCT-1V1D	CAT	CA32
1 Stranded	2 Stranded	CAPCP-1Y1V	CAP	CA65
	4 Stranded	CAPCP-1Y1L	CAP	CA45
	6 Stranded	CAPCP-1Y1H	CAP	CA45
	6 Solid	CAPCP-1Y1G	CAP	CA45
	8 Stranded	CAPCP-1Y1E	CAP	CA45
	8 Solid	CAPCP-1Y1D	CAP	CA45
1/0 Stranded	2 Stranded	CAPCP-2C1V	CAP	CA65
	4 Stranded	CAPCP-2C1L	CAP	CA65
	6 Stranded	CAPCP-2C1H	CAP	CA45
	6 Solid	CAPCP-2C1G	CAP	CA45
	8 Stranded	CAPCP-2C1E	CAP	CA45
	8 Solid	CAPCP-2C1D	CAP	CA45
2/0 Stranded	2 Stranded	CAPCN-2G1V	CAN	2-CA45
	4 Stranded	CAPCP-2G1L	CAP	CA65
	6 Stranded	CAPCP-2G1H	CAP	CA65
	6 Solid	CAPCP-2G1G	CAP	CA65
	8 Stranded	CAPCP-2G1E	CAP	CA65
	8 Solid	CAPCP-2G1D	CAP	CA65


\* For #10 Solid through #14 Tap, use sleeve CAB-133-1H on wire in welder for #6 Stranded Tap.

† Welder Part No. includes mold frame. If mold only (less frame) is required, order - Welder Part No. - "M".

# Connections of Cable to Cable

## Type CASS

Type CASS  
Splice of conductors.

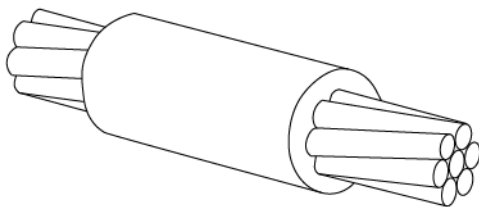

Conductor Size	Welder Part No.†	Welder Price	Weld Metal
12 Solid	CASST-001	CAT	CA15
10 Solid	CASST-1A	CAT	CA15
8 Solid	CASST-1D	CAT	CA15
6 Solid	CASST-1G	CAT	CA25
6 Stranded	CASST-1H	CAT	CA25
4 Solid	CASST-1K	CAT	CA25
4 Stranded	CASST-1L	CAT	CA25
2 Solid	CASST-1T	CAT	CA32
2 Stranded	CASST-1V	CAT	CA32
1 Stranded	CASST-1Y	CAT	CA32
1/0 Stranded	CASSP-2C	CAP	CA45
2/0 Stranded	CASSP-2G	CAP	CA65

† Welder Part No. includes mold frame. If mold only (less frame) is required, order - Welder Part No. - "M".

